
USB Driver Installation Errors - Code 52 & vendor.cer

721 Ron De Pastino September 7, 2022 N2KAnalyzer, N2KAnalyzer , USB100, USB100 0 11.92K

With the release of N2KAnalyzer 3.0.4 we introduced a new USB driver that provided better support for Windows Operating Systems 7 - 11 for 32-bit and 64-bit architectures.


The following errors may occur on Windows 7, 8, 8.1 installations while updating the USB driver to version 2.15.

Code 52

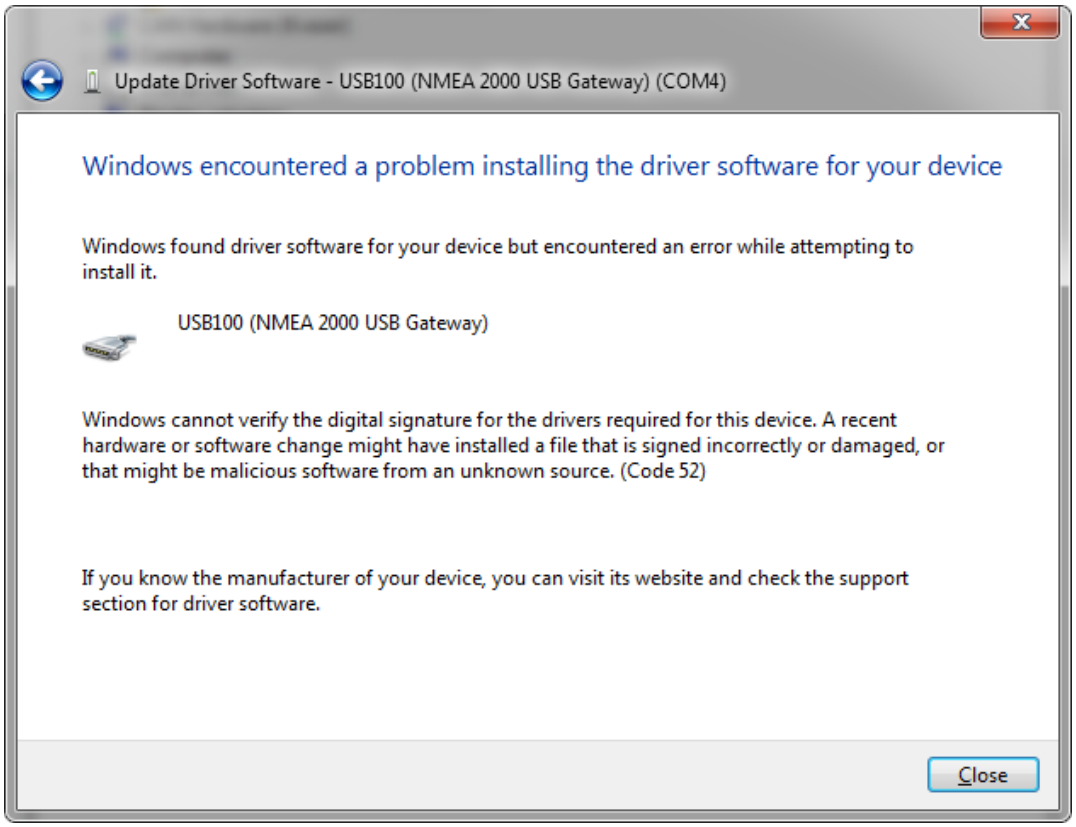

OR


File(s) 'vendro.cer' not found in 'C:Program FilesCarlingTechUSBCOM Driver'.

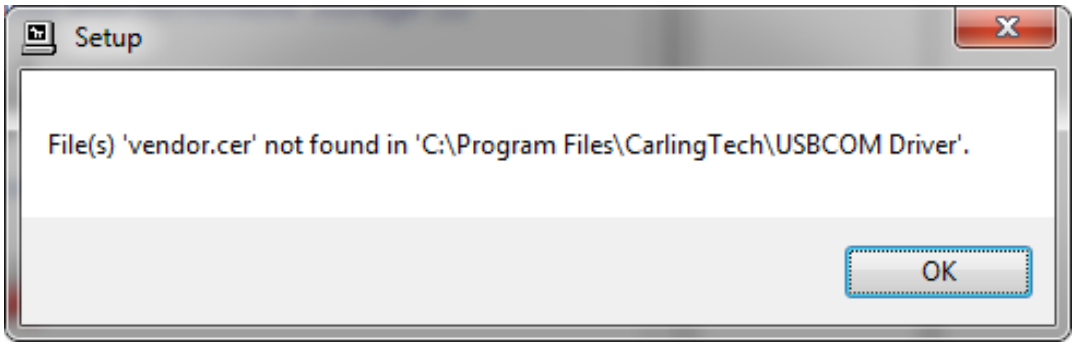

This is due to an outdated/missing security update for the Windows Operating System.

Please download and install the following Microsoft Security Update: **KB3033929**

https://www.microsoft.com/en-us/download/details.aspx?id=46148

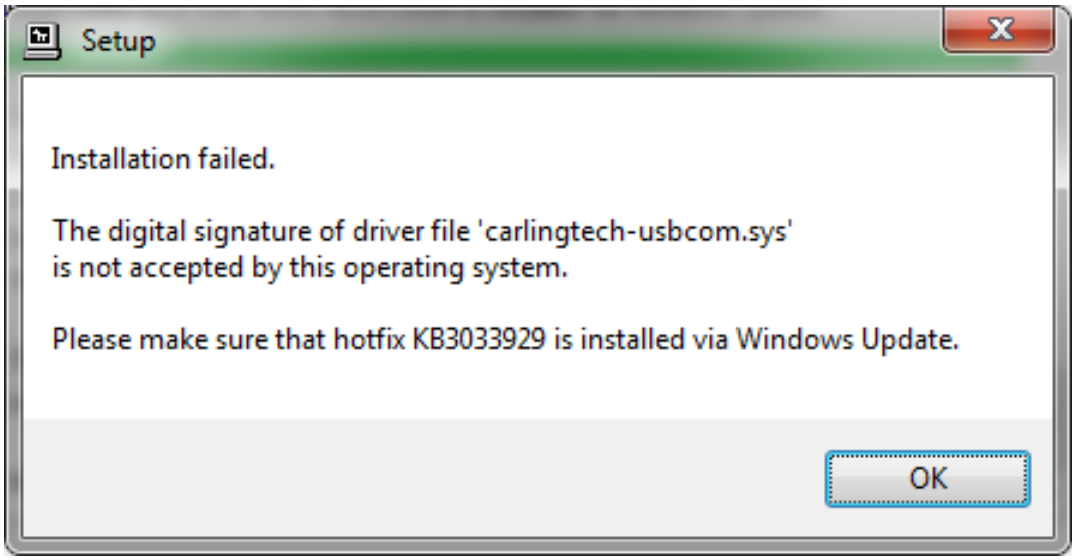

Once the update is installed, please install the latest Maretron USB Driver.

https://www.maretron.com/support/downloads.php

If you continue to experience any issues please contact Maretron Support at (866) 550-9100 or via email at Support@Maretron.com.

Online URL: https://maretron.com/wp-content/phpkbv96/article.php?id=721